

# **Appliance - Reed Sensor**

Reed Sensors Detect Dishwasher Spray Arm Obstruction



### Introduction

Most modern kitchens today have as an essential component - a dishwasher. Actually dishwashers if designed properly can be very power efficient and represent a healthier approach to washing dishes. One of the essential actions that takes place within the dishwasher is rotation of the spray arm. This generally sprays hot water/steam and/or hot air under high pressure to all the dishes. If a dish is improperly positioned in the washer blocking the rotation of the spray arm trouble will ensue. However, reed sensors have solved this commonly occurring problem.

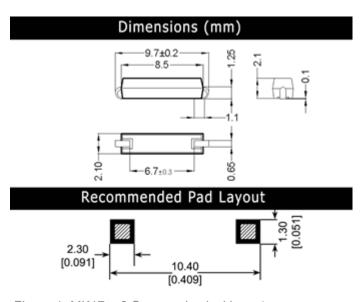


Figure 1. MK17-x-3 Sensor physical layout

#### **Features**

- Magnet and Reed Sensor are isolated and have no physical contact by typically having the magnet mounted to the spray arm and the Reed Sensor is mounted on the inner casing of the body such that it will detect the magnetic field of magnet on the spray arm when it rotates by the reed sensor.
- The reed switch used in the Reed Sensor is hermetically sealed and is therefore not

- sensitive to rough, wet, moist, high temperature environments
- The magnet is not affected by its environment
- Tens of millions of reliable operations
- Surface mount and through hole packages available
- Cylindrical hole and screw fastening mounting
- Contacts dynamically tested

### **Applications**

- Ideal for sensing the rotating dishwasher spray arm
- Ideal for applications sensing any kind of rotation in a host of different configurations

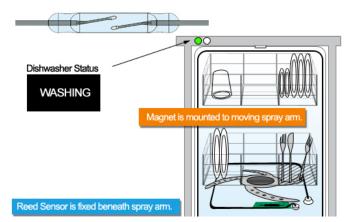


Figure 2. A magnet is mounted to the underside of the dishwasher spray arm and its rotation is sensed when it passes over the reed switch sensor mounted to the bottom of the dishwasher.

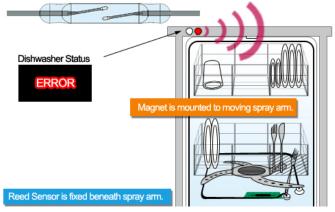


Figure 3. When there is an obstruction to the spray arm, the magnet and arm do not rotate causing the sensor to send a signal to the electronics sounding an alarm and turning off the dishwasher.

## Reed Sensors Solve the Spray Arm Blockage Problem

People take their dishwashers for granted assuming they will get the job done. In most cases this is a good assumption. However, many people like to run their washer only when it is completely full and sometimes overloaded. In the overloaded case, a dish or utensil may be inadvertently in the way of the rotating spray arm blocking the rotation. In this case two things happen: first, the spray arm is not

Surface Mount Sensor Series				
	Dimer	nsions		
Series		mm	inches	Illustration
MK15	W	2.5	0.098	
		2.5	0.098	
	L	19.50	0.768	
	W	2.3	0.091	
MK16	Н	2.3	0.091	
	L	15.60	0.614	
	W	2.1	0.083	
MK17	Н	2.1	0.083	
	L	9.61	0.378	
	W	2.7	1.060	
MK22	Н	2.3	0.091	
	L	15.60	0.614	
	W	2.2	0.087	
MK23-35	Н	1.95	0.077	
	L	15.75	0.620	
	W	2.2	0.087	
MK23-66	Н	2.7	1.060	- Common of the
	L	19.60	0.772	
MK23-87	W	2.0	0.079	
	Н	2.1	0.083	· Comments
	L	15.60	0.614	
	W	2.54	0.100	
MK23-90	Н	3.05	0.120	-
	L	24.9	0.980	

longer rotating and is therefore only spraying in one area only; and secondly, when the motor is stopped from rotating (called a locked rotor condition), the motor will automatically increase the current, and therefore increasing power trying to start the motor moving. This heavy draw of power dramatically reduces the efficiency and potentially could burn out the motor. Furthermore, the dishes end up not very clean with the spray only penetrating certain dish areas.

Specifications (@ 20°C) MK15 & MK06 Series						
	Min	Max	Units			
Operate Specifications	Operate Specifications					
Must close distance	5	25	mm			
Must open distance	5	25	mm			
Hysteresis	Typica					
Load characteristics						
Switching voltage		200	V			
Switching current		0.5	Amps			
Carry current		1.5	Amps			
Contact rating		10	Watts			
Static contact resistance		150	mΩ			
Dynamic contact resistance	200		mΩ			
Breakdown voltage	320		V			
Operate time		0.5	msec			
Release time		0.1	msec			
Operate temp MK06	-20	85	°C			
Storage temp MK06	-20	85	°C			
Operate temp MK15	-20	130	°C			
Storage temp MK15	-20	130	°C			

## Dimensions (mm)

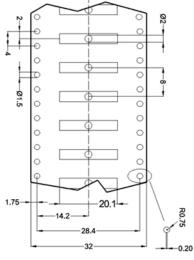


Figure 4. MK15 Tape & Reel

Dishwasher manufacturers offer models where this problem is solved using reed sensors.

A magnet is generally mounted to the spray arm/s and rotates with the spray arm. A reed sensor is conveniently mounted to the internal chassis such that it will be energized with every rotation of the spray arm. When the spray arm is blocked, the reed sensor fails to energize, which sends a signal to the electronics alerting it that the spray arm is no longer operating. In this case, three things generally happen:

Cylindrical Panel Mount Sensor Series				
	Dimen	sions mm	inches	Illustration
Series				
	D	5.25	0.207	
MK03	L	25.5	1.004	
	D	4	0.157	.2
MK14	L	25.5	1.004	
	D	5	0.197	
MK18	L	17	0.669	
	D	2.72	0.107	
MK20/1	L	10	0.394	

	Rectangular Panel Mount Sensor Series			
	Dimen	sions		
		mm	inches	Illustration
Series				
	W	13.9	0.547	
MK04	Н	5.9	0.232	( total
	L	23.0	0.906	
	W	19.6	0.772	
MK05	Н	6.1	0.240	
	L	23.2	0.913	
	W	14.9	0.587	
MK12	Н	6.9	0.272	
	L	32.0	1.260	

1. a signal is sent to turn off the spray arm motor, 2. a light on the outside panel begins to flash; and 3. a beeper begins to alert the user of the jam internally in the dishwasher. Once the blockage is removed the dishwasher is reset and will resume its normal operation.

In this application, the reed sensor may be in a direct line with the sprays including the high and low temperatures. Because Standex's sensors use hermetically sealed reed switches that are further packaged in strong high strength plastic, they can be subject to rough treatment and environmental concerns such as water sprays, and moisture without any loss of reliability.

	Т	hrough H	Hole Senso	r Series
	Dimer	nsions		
		mm	inches	Illustration
Series				
MK06-4	W	3.3	0.130	71
	Н	3.3	0.130	
	L	12.06	0.475	
MK06-5	W	2.8	0.110	L
	Н	3.2	0.126	
	L	14.30	0.563	
MK06-6	W	3.3	0.130	
	Н	4.2	0.165	
	L	17.24	0.679	
MK06-7	W	3.3	0.130	L
	Н	4.2	0.165	
	L	19.78	0.779	

<sup>\*\*</sup>Consult the factory for more options not listed above.

## Application Alley

### Appliance - Reed Sensor

Reed Sensors Detect Dishwasher Spray Arm Obstruction

The reed sensor reed sensor is an excellent choice because it can operate reliably over a wide temperature range, and represents an economical way to carry out the sensing function. Standex's sensors are packaged for surface mounting as well as through hole mounting. Also, Standex has cylinder packages as well as screw fastening packages having lead wires for remote attachment to the electronics.

Find out more about our ability to propel your business with our products by visiting www.standexelectronics.com or by giving us a hello@standexelectronics.com today! One of our engineers or solution selling sales leaders will listen to you immediately.

#### **About Standex Electronics**

Standex Electronics is a worldwide market leader in the design, engineering, and manufacture of standard and custom electro-magnetic components, including magnetics products and reed switch-based solutions.

Our magnetics offerings include planar, current sense, and conventional low- and high-frequency transformers and inductors. Reed switch-based solutions include Meder, Kent, and KOFU brand reed switches, as well as a complete portfolio of reed relays, and a comprehensive array of fluid level, proximity, motion, water flow, HVAC condensate, hydraulic pressure differential, capacitive, conductive and inductive sensors.

We offer engineered product solutions for a broad range of product applications in the transportation, automotive, medical, test and measurement, military and aerospace, aviation, HVAC, appliance, security and safety, and general power and industrial markets.

Standex Electronics has a commitment to absolute customer satisfaction through a partner, solve, and deliver approach. With a global organization that offers sales support, engineering capabilities, and technical resources worldwide – we implement customer driven innovation that puts the customer first.

For more information on Standex Electronics, visit us on the web at standex electronics.com.

#### **Contact Information:**

### **Standex Electronics**

World Headquarters 4538 Camberwell Road Cincinnati, OH 45209 USA

**Standex** Americas (OH) +1.866.STANDEX (+1.866.782.6339) info@standexelectronics.com

**Standex Electronics** Asia (Shanghai)

+86.21.37606000 salesasia@standexelectronics.com

Standex Electronics Europe (Germany)

+49.7731.8399.0 info@standexelectronics.com

Standex Electronics India (Chennai)

+91.98867.57533 kkasaragod@standexelectronics.com

Standex Electronics Japan (Kofu)

+81.42.698.0026 sej-sales@standex.co.jp

